## SUZUKI SV650 2015-2024 DL650 V-STROM/XT 2017-2024

FITTING INSTRUCTIONS **GBRacing**® TO BE FITTED BY A QUALIFIED TECHNICIAN



GBRacing®

. Bolt 4 M6X75HHF 8Nm

Bolt 1 M6X55HHF

8Nm

Bolt 3

8Nm

M6X55HHF

Bolt 2


THIS SHEET INCLUDES FITTING INSTRUCTIONS FOR THE FOLLOWING PARTS:

Secondary Alternator Cover Part No. EC-SV650-2015-1-GBR / Secondary Clutch Cover Part No. EC-SV650-2015-2-GBR / Secondary Water Pump Cover Part No. EC-SV650-2015-5-GBR

### SECONDARY ALTERNATOR COVER PART NO. EC-SV650-2015-1-GBR


- Remove 4 existing bolts from the Alternator cover, shown as position Bolt 1, 2, 3 & 4. 1 Note: Retain the 2 stock oil seal washers found at bolt positions 1 & 2.
- 2 Assemble supplied M6WCU copper oil seal washer onto supplied replacement bolts 1 & 2
- 3 Assemble bolts 1 & 2 through secondary alternator cover, re-assemble retained stock oil seal washers onto the underside of bolts 1 & 2.
- M6X55HHF 4 Assemble secondary alternator cover on top of stock cover and assemble remaining bolts 8Nm 3 & 4 into position.
- Tighten bolts to a Torque of 8 Nm as per manufacturer's recommendations. 5 DO NOT OVERTIGHTEN.



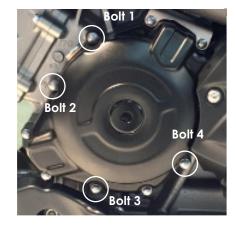

## SECONDARY CLUTCH COVER PART NO. EC-SV650-2015-2-GBR

- 1 Remove 4 existing bolts from the Clutch cover, shown as position Bolt 1, 2, 3 & 4.
- 2 Place the Secondary Clutch Cover over the stock cover.
- 3 Assemble 4 replacement bolts loosely in the correct position as shown. Note: Must use thread lock
- Tighten bolts to a Torque of 8 Nm as per manufacturer's recommendations. 4 DO NOT OVERTIGHTEN.
- 5 Note: For DL650 L2 (2012) < Remove offside rider peg complete with hanger. Just 2 bolts. Re-apply thread lock.

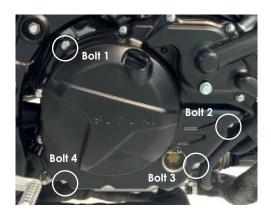



# SUZUKI SV650 2015-2024 DL650 V-STROM/XT 2017-2024

FITTING INSTRUCTIONS GBRacing® TO BE FITTED BY A QUALIFIED TECHNICIAN



#### SECONDARY WATER PUMP COVER PART NO. EC-SV650-2015-5-GBR

- Remove 3 existing bolts from the clutch cover, shown as position Bolt 1, 2, & 3. 1
- Place the secondary water pump cover over the stock cover. 2
- 3 Assemble 3 replacement bolts loosely in the correct position as shown.
- 4 Tighten bolts to a Torque of 8 Nm as per manufacturer's recommendations. DO NOT OVERTIGHTEN.





### Engine Cover Set: EC-SV650-2015-SET-GBR

EC-SV650-2015-1-GBR, EC-SV650-2015-2-GBR, EC-SV650-2015-5-GBR